


INTERLOCKING NAME WINANS

DATE: 3-5-83 WALKED BY: JJC

ITEMS	A	1	2	3	4	TOTAL	DETAILED REMARKS	
CROSS TIES	35	124				159	TIES	#1 35 = BETW. #15-SBHS #1 56 = BETW. SBHS-#21 54 = BETW. #21-#15 14 = BETW. #15-NBHS
TIMBERS	-	14				14	TIMBERS	#15 SW 6-10' 4-14' 2-13' 2-16'
CWR	48	92				140	CWR	#1 ELIMINATE GLUED JOINTS AT OLD SBHS. 48' = E. RL. #2 ELIMINATE GLUED JOINTS AT OLD 1033 SIG. LOCATION. 48' = E. RL. 44' = W. RL.
BUFFERS	1	-	-	2		3	BUFFER	#1 ELIMINATE GLUED JOINTS AT OLD SBHS. 34' = W. RL. #3 ELIMINATE GLUED JOINTS AT OLD 1033 SIG. 34' = E. RL. 32' = W. RL.
INSULATED JOINTS	-	1	2	-		3	I J	#1 1 = #15 COUPLED W. RL. #2 2 = #21 XOVER (DEFECTIVE)
GLUE OR FREEZE JOINTS	-	2	2	-		4	GLUE	#1 2 = #21 TOE FROG #2 2 = #21 TOE FROG
WELDS	8	29	16	4		57	WELDS	#1 2 = E. RL. ACROSS #21 N 2 = W. RL. ACROSS #21 N 2 = E. RL. ACROSS #21 S 2 = W. RL. ACROSS #21 S #2 2 = E. RL. SBHS 2 = W. RL. SBHS 4 = E. RL. #21 3 = W. RL. #21 5 = E. RL. #15 8 = W. RL. #15 #3 2 = E. RL. OLD 1033 SIG. 2 = W. RL. OLD 1033 SIG. #2 2 = E. RL. NBHS 2 = W. RL. NBHS 4 = E. RL. #21 3 = W. RL. #21 2 = E. RL. SBHS 3 = W. RL. SBHS
OTHER								

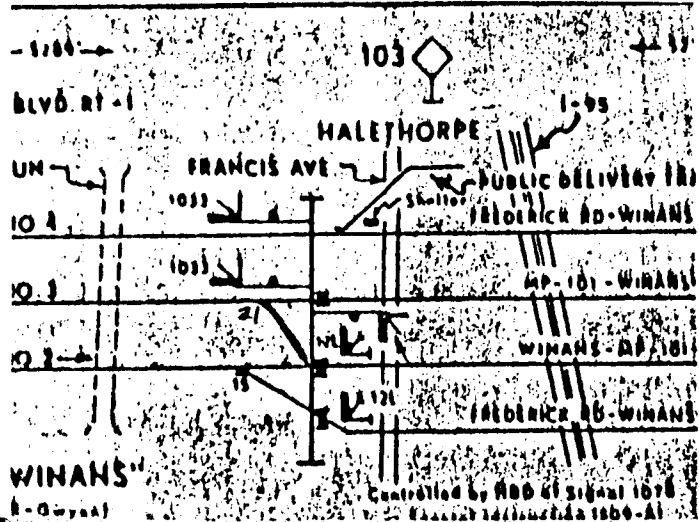

OTHER

#15 SW GRIND AT/ST. RL.
#5 ROD SLIPPING THRU TEETH.
WELD OR RENEW FROG
(3 LEGS OF OLD ONE WELDED IN)

#21 CUT OFF HEAD TIES.
SPIKES MISSING HEGL FROG.

USE GLUED JOINTS ELIMINATED TO REPLACE DEFECTIVE ONES IN #21 XOVER.
REPLACE CLIPS ON GLUED JOINTS AND WELDS.
LEFTOVER CLEANUP IMMEDIATE DRAINAGE.

WELD COUNT IS AFTER ALL RAIL INSTALLED.