

INTERLOCKING NAME


BOWIE

DATE: 3-25-83

WALKED BY: JJC BSA

ITEMS	A	1	2	3	4	TOTAL
CROSS TIES	—	48	122	68	—	238
TIMBERS	—	22	—	—	—	22
CANNOT BE DONE CWR UNTIL INTRKLG. RECONFIGURATION CAN DO NOW	—	516	1658	1264	—	3438 640
BUFFERS	—	—	4	—	—	4
INSULATED JOINTS	—	—	—	—	—	—
GLUE OR FREEZE JOINTS	—	6	4	2	—	12
WELDS	—	27	31	9	—	67

		DETAILED REMARKS		
TIES	#1	12 BETW. SBHS-#3	#2	53 BETW. NBHS-#2
		10 BETW. #3-#11		22 BETW. #32-#21
TIMB	#1	16 BETW. #11-#13	#3	3 BETW. NBHS-#32
		5 BETW. #13-#21		27 BETW. #32-#9
CWR	#1	5 BETW. #21-SW. S. LEG		25 BETW. #9-#5
				13 S. OF SBHS
GLUE FREEZE	#1	SE #11 7-10'	#2	ELIMINATE OLD NBHS
		4-11'		42' E. RL.
B U F F E R	#1	11-12'	#2	84' E. RL.
				54' W. RL.
O T H E R	#1	ELIMINATE OLD NBHS	#3	ELIM. OLD NBHS
		42' E. RL.		60' E. RL.
W E L D	#1	42' W. RL.		100' W. RL.
		ELIMINATE OLD #3 XOVER		ELIM. OLD #9 XOVER
G L U E	#1	116' E. RL.		250' E. RL.
		316' W. RL.		250' W. RL.
F R E E Z E	#1	200' W. RL. N. OF #11		ELIM. OLD #3 + #5 XOVERS.
		220' E. RL. BETW #11-#13		215' E. RL.
O T H E R	#1	220' W. RL. BETW #11-#13		289' W. RL.
				ELIM. OLD #5 XOVER
W E L D	#2	18' E. RL. S. OF #32	#2	2 TOE #32
		18' W. RL. S. OF #32		2 TOE #21
O T H E R	#2	18' E. RL. #32	#3	2 TOE #32
		18' W. RL. #32		

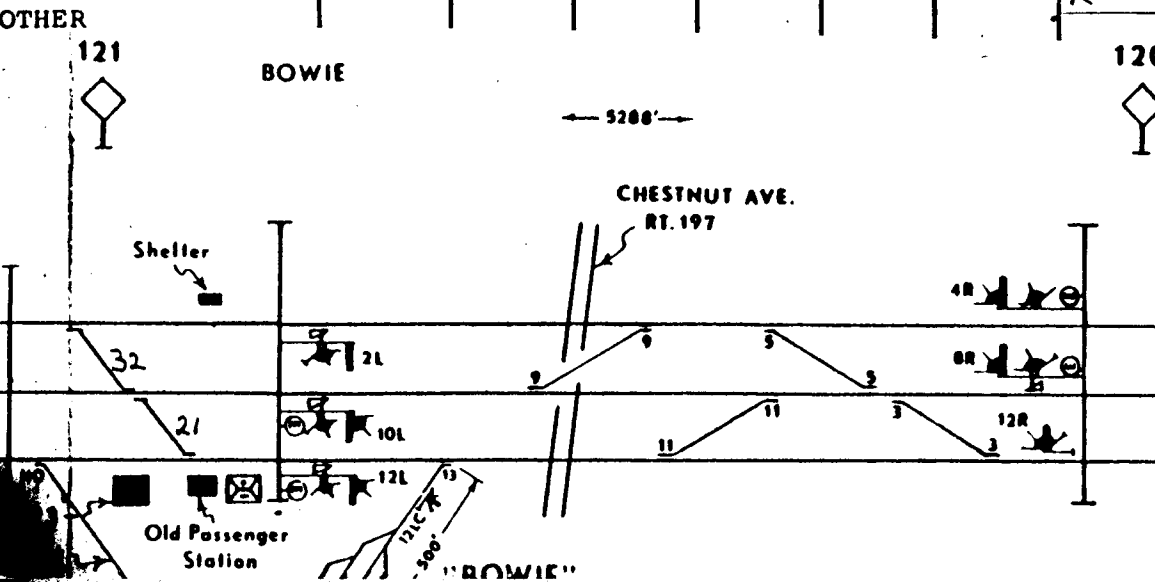

- 120 WELD
- #1 2 W. RL. BETW #3-#11
  - 2 E. RL. BETW #11-#13
  - 2 W. RL. BETW #11-#13
  - 8 #13
  - 3 #21
  - 4 #21-SW. S. LEG
  - 2 SW. S. LEG
  - 4 NBHS
  - #2 4 NBHS
  - 4 S. OF #32
  - 3 #32
  - 4 BETW #32-#21
  - 6 #21
  - 6 #11
  - 4 SBHS
  - #3 4 NBHS
  - 3 #32
  - 2 PLATFORM

- O T H E R
1. OTHER WORK WITH PRS LATER
  2. SUPVR. MUST RUN GAUGE THROUGH INTLG.
  3. CLIPS OFF AT HOME SIGNALS.
  4. ANCHOR PATTERN SPARATIC-ADD ANCHORS.
  5. 800'± FIT CWR AT N.E. INT. #1
  6. CAN SAVE ABOUT 300' CWR XOVER (SEE PLAN)